

Sony Service Company
 National Technical Services
 A Division of Sony Electronics Inc.
 San Diego, Ca 92127

MODELS:

KDL-40W580B, KDL-40W590B, KDL-40W600B
 KDL-48W580B, KDL-48W590B, KDL-48W600B

No. E58409669

Date: 10/1/2015

SERIAL NUMBERS AFFECTED:

See table 1

CHASSIS:

RB2G HM

SUBJECT:

BAX-L / BAX-L HM Main Board Information

SYMPTOM:

Compatibility issue when changing board type.

CAUSE:


New LCD, Main board and Flexible Flat Cable combination.

SOLUTION:

Replace parts to match accordingly by serial number.
 Use correct Flexible Flat Cable if changing board type.
 Update software to latest version.

Table 1

Model Name	Serial No.	Main Board BAX-L	Main Board BAX-L HM	Flexible Flat Cable
KDL-40W580/590/600B	5,000,001 - 8,100,000	A-2037-764-A		1-848-217-11
KDL-40W580/590/600B	8,100,001 - 8,500,000		A-2074-643-A	1-849-049-11
KDL-48W580/590/600B	5,000,001 - 8,100,000	A-2037-764-A		1-848-218-11
KDL-48W580/590/600B	8,100,001 - 8,500,000		A-2074-643-A	1-849-049-11

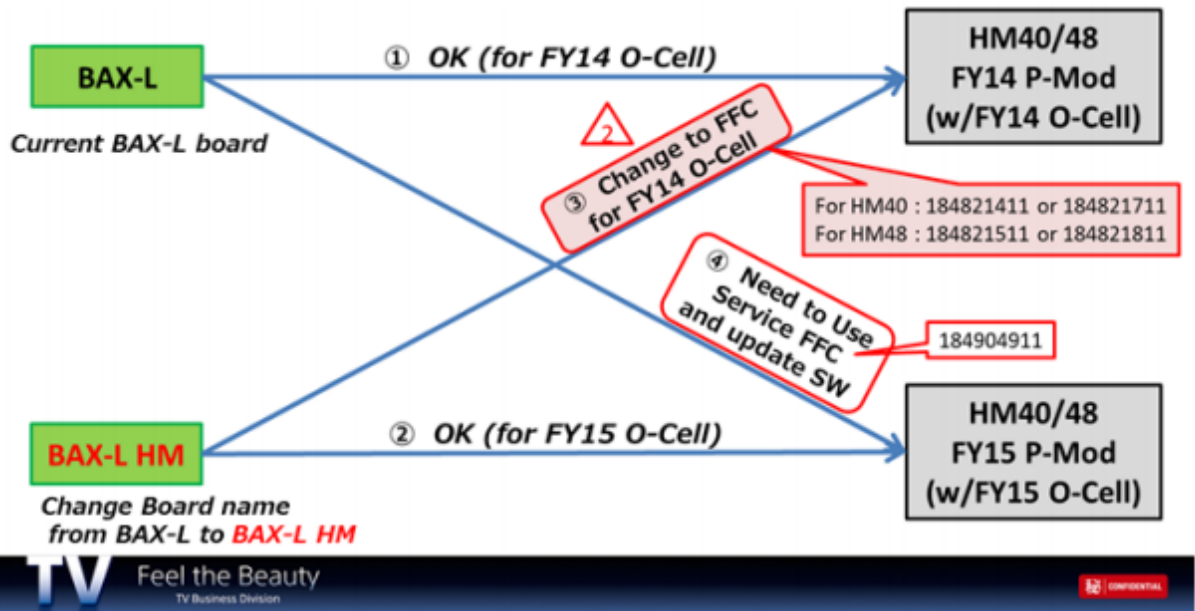

Case ③ : Need to use FFC for FY14 O-Cell

For HM40 : 184821411 or 184821711 For HM48 : 184821511 or 184821811

Case ④ : Need to use Service FFC and update SW (latest) before this change *SW PKG 2.282 or the latest